LOC/DME I-DXU	APP CRS	Rwy ldg 16000
111.9	350°	TDZE 5324
Chan 56		Apt Elev 5431

ILS RWY 34L (CAT III)
DENVER INTL (DEN)

Simultaneous approaches authorized with Rwy 35L and 35R.

ALSF-2

MISSED APPROACH: Climb to 5800, then climbing left turn to 12000 via 270° heading and FQF VORTAC R-306 to HYGEN INT/FQF 37.9 DME and hold.

ATIS	DENVER APP CON	DENVER TOWER	GND CON	CLNC DEL
125.6 379.9	119.3 307.3 (NORTH) 120.35 379.3 (SOUTH)	135.3 351.95	127.5 379.175	118.75

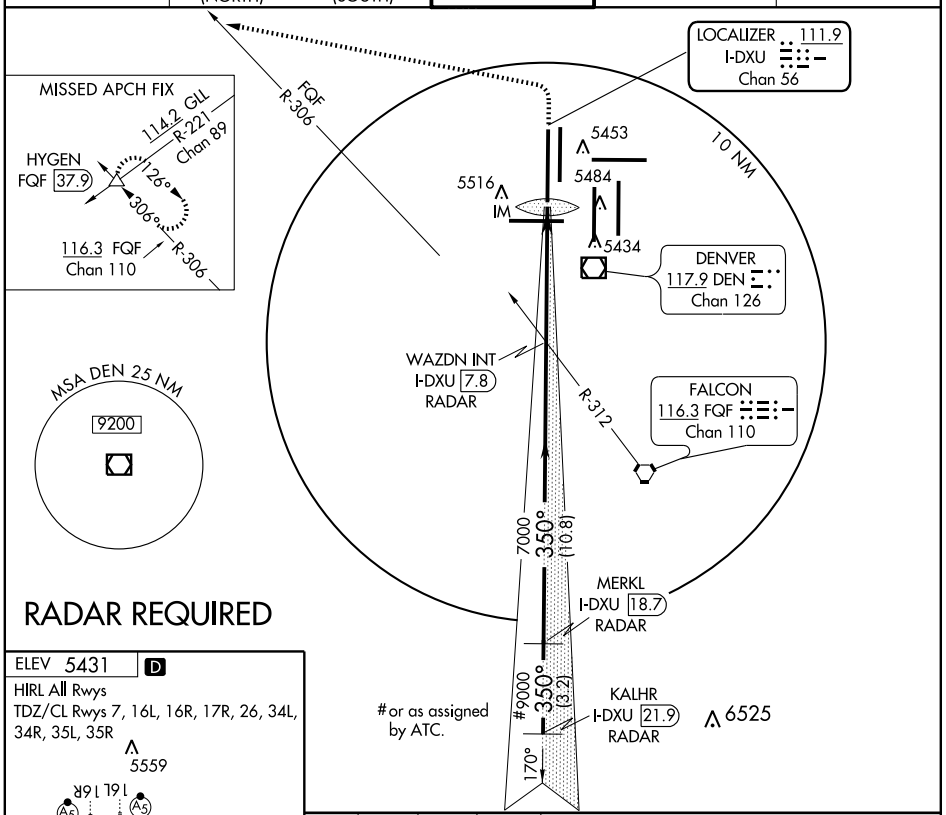

RADAR REQUIRED

ELEV 5431 D

HIRL All Rwys

TDZ/CL Rwys 7, 16L, 16R, 17R, 26, 34L, 34R, 35L, 35R

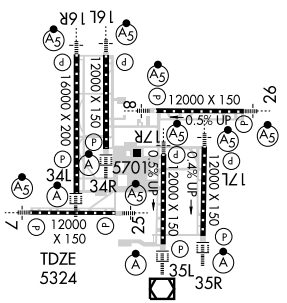

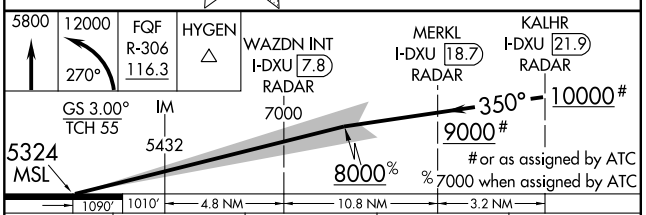

CATEGORY	A	B	C	D
S-ILS 34L	CAT IIIA RVR 07			
S-ILS 34L	CAT IIIB RVR 03			
S-ILS 34L	CAT IIIC NA			

CATEGORY III ILS - SPECIAL AIRCREW & AIRCRAFT CERTIFICATION REQUIRED

SW-1, 19 NOV 2009 to 17 DEC 2009

SW-1, 19 NOV 2009 to 17 DEC 2009