LOC/DME I-DXU	APP CRS	Rwy Idg 16000
111.9	350°	TDZE 5324
Chan 56		Apt Elev 5431

ILS RWY 34L (CAT II)
DENVER INTL (DEN)

Simultaneous approaches authorized with Rwy 35L and 35R.

ALSF-2

MISSED APPROACH: Climb to 5800, then climbing left turn to 12000 via 270° heading and FQF VORTAC R-306 to HYGEN INT/FQF 37.9 DME and hold.

ATIS	DENVER APP CON	DENVER TOWER	GND CON	CLNC DEL
125.6 379.9	119.3 307.3 (NORTH) 120.35 379.3 (SOUTH)	135.3 351.95	127.5 379.175	118.75

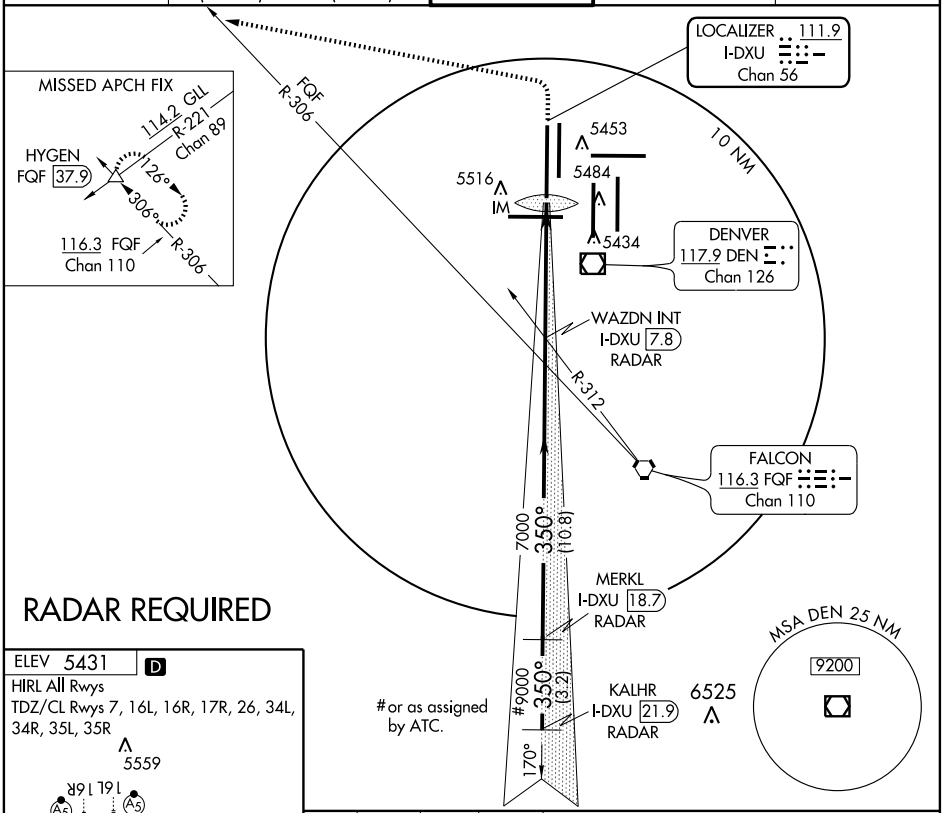

ELEV 5431 D

HIRL All Rwys

TDZ/CL Rwys 7, 16L, 16R, 17R, 26, 34L, 34R, 35L, 35R

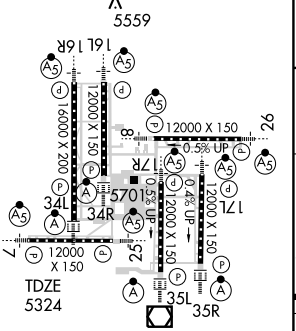

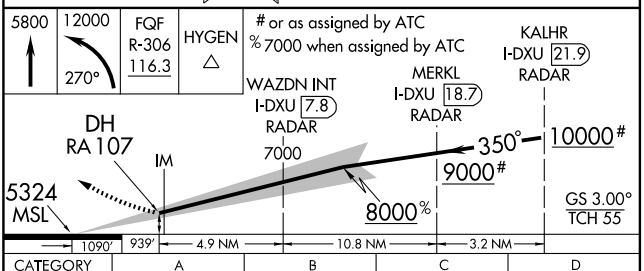

CATEGORY	A	B	C	D
S-ILS 34L	RA 107/12 100 DA 5424			

CATEGORY II ILS - SPECIAL AIRCREW & AIRCRAFT CERTIFICATION REQUIRED

SW-1, 11 MAR 2010 to 08 APR 2010
SW-1, 11 MAR 2010 to 08 APR 2010