

LOC/DME I-DPP 110.15 Chan 38 (Y)	APP CRS 350°	Rwy Idg 12000 TDZE 5367 Apt Elev 5431
--	------------------------	--


ILS RWY 35R (CAT III)

DENVER INTL (DEN)

Simultaneous approaches authorized with Rwy 34R and Rwy 35L. MISSED APPROACH: Climb to 5800, then climbing right turn to 10000 via 045° heading and GLL VORTAC R-136 to CEDUK INT/ GLL 16 DME and hold.



ATIS 125.6 379.9	DENVER APP CON 119.3 307.3 120.35 379.3 (NORTH) (SOUTH)	DENVER TOWER 124.3 256.85	GND CON 121.85 377.1	CLNC DEL 118.75
----------------------------	--	-------------------------------------	--------------------------------	---------------------------

RADAR REQUIRED

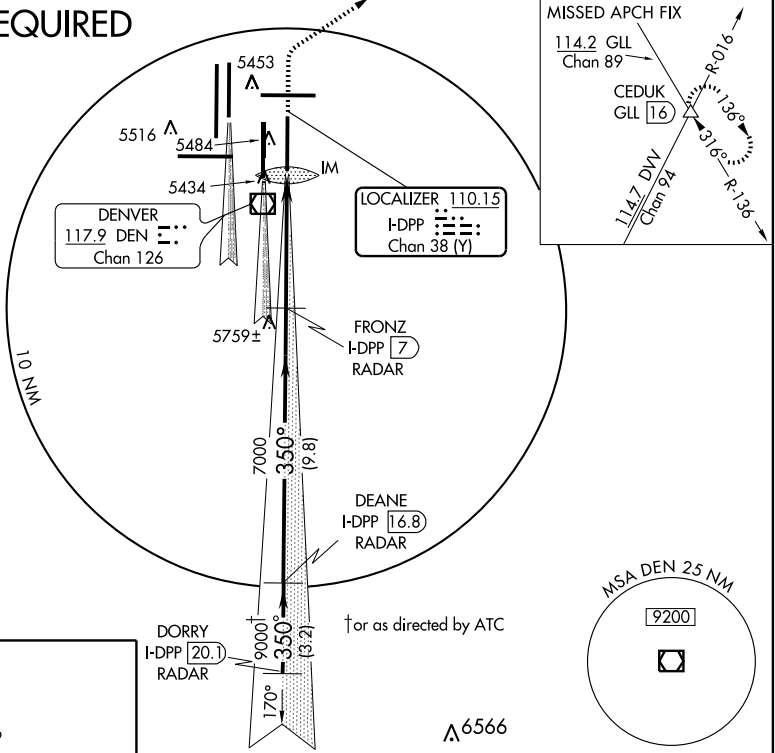

SW-1, 19 NOV 2009 to 17 DEC 2009

SW-1, 19 NOV 2009 to 17 DEC 2009

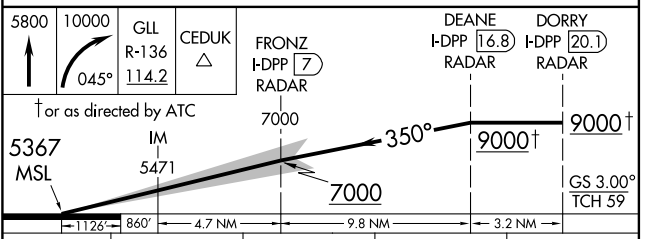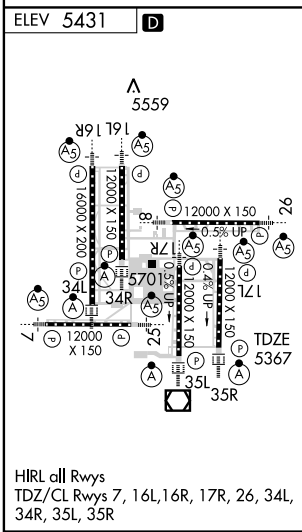

CATEGORY	A	B	C	D
S-ILS 35R		CAT IIIA	RVR 07	
S-ILS 35R		CAT IIIB	RVR 03	
S-ILS 35R		CAT IIIC	NA	

CATEGORY III ILS - SPECIAL AIRCREW & AIRCRAFT CERTIFICATION REQUIRED